



PROBLEM SOLVING GUIDE



Efflorescence

The natural water-soluble salts that can occur when cement based materials cure.

OPTIONS	STEPS
<p>EFFLORESCENCE REMOVER</p>  <p>COVERAGE 50 TO 250 SQ. FT. PER GALLON</p>	<ol style="list-style-type: none"> 1. SWEEP OR VACUUM SURFACE TO BE CLEANED TO REMOVE ANY LOOSE CONTAMINANTS. 2. APPLY A SMALL AMOUNT OF WATER TO THE SURFACE TO BE CLEANED. 3. APPLY EFFLORESCENCE REMOVER LIBERALLY USING A SPONGAUSA™ SPONGE, OR A MOP, PAINT-PAD APPLICATOR, PAINT ROLLER, BRUSH OR LOW PRESSURE PUMP SPRAYER. 4. ALLOW EFFLORESCENCE REMOVER TO DWELL FOR UP TO 10 MINUTES ON SURFACE. 5. APPLY A SECOND COAT OF EFFLORESCENCE REMOVER IN SAME MANNER AS STEP #3. 6. ALLOW SECOND COAT OF EFFLORESCENCE REMOVER TO DWELL ON SURFACE FOR UP TO 10 MINUTES. 7. AGITATE WITH A PRIMO TOOLS™ WHITE NYLON SCRUB PAD OR OTHER COMPARABLE NON-MARRING SCRUBBING TOOL UNTIL EFFLORESCENCE IS REMOVED FROM SURFACE. 8. THOROUGHLY RINSE SURFACE WITH WATER. A WET/DRY VACUUM MAY ALSO BE USED. 9. SOME SURFACES MAY REQUIRE ADDITIONAL APPLICATIONS. EXPERT TIP: HIGH-PRESSURE (1000 – 3000 PSI) SPRAYERS ARE HIGHLY EFFECTIVE AT RINSING AWAY EFFLORESCENCE STAINS WHEN USED IN CONJUNCTION WITH EFFLORESCENCE REMOVER. 10. WIPE SURFACE COMPLETELY DRY USING A CLEAN, DRY, WHITE COTTON OR MICRO-FIBER TOWEL. 11. IF SURFACE IS TO BE SEALED, ALLOW 24 HOURS DRYING TIME PRIOR TO APPLYING A HIGH QUALITY OMNI SEALER.
<p>BUFFERED ACID CLEANER</p>  <p>COVERAGE 500 TO 2,000 SQ. FT. PER GALLON</p>	<ol style="list-style-type: none"> 1. SWEEP OR VACUUM SURFACE TO BE CLEANED TO REMOVE ANY LOOSE CONTAMINANTS. 2. USE FULL STRENGTH OR DILUTE WITH WATER TO MATCH CLEANING NEEDS: FULL STRENGTH – EXTREME DUTY; 1 PART TO 2 PARTS WATER – HEAVY DUTY; 1 PART TO 5 PARTS WATER – MEDIUM DUTY; 1 PART TO 15 PARTS WATER – LIGHT DUTY 3. APPLY A LIBERAL AMOUNT OF WATER TO THE SURFACE TO BE CLEANED. 4. APPLY BUFFERED ACID CLEANER USING A SPONGAUSA™ SPONGE, OR A MOP OR BRUSH. 5. EXPERT TIP: FOR LARGE PROJECTS, DIVIDE WORKING AREA INTO MANAGEABLE SECTIONS OF APPROX. 25 SQ. FT. 6. ALLOW BUFFERED ACID CLEANER TO DWELL ON SURFACE FOR 1 TO 5 MINUTES ON SURFACE. 7. AGITATE WITH A PRIMO TOOLS™ WHITE NYLON SCRUB PAD, OR BRUSH OR OTHER COMPARABLE NON-MARRING SCRUBBING TOOL UNTIL CONTAMINATE OR STAIN IS REMOVED FROM SURFACE. 8. THOROUGHLY RINSE SURFACE WITH WATER. A WET/DRY VACUUM MAY ALSO BE USED. 9. SOME SURFACES MAY REQUIRE ADDITIONAL APPLICATIONS. 10. EXPERT TIP: HIGH-PRESSURE (1000 – 3000 PSI) SPRAYERS ARE HIGHLY EFFECTIVE AT RINSING AWAY CONTAMINANTS AND STAINS WHEN USED IN CONJUNCTION WITH BUFFERED ACID CLEANER. 11. WIPE SURFACE COMPLETELY DRY USING A CLEAN, DRY, WHITE COTTON OR MICRO-FIBER TOWEL. 12. IF SURFACE IS TO BE SEALED, ALLOW 24 HOURS DRYING TIME PRIOR TO APPLYING A HIGH QUALITY OMNI SEALER. EXPERT TIP: BUFFERED ACID CLEANER MAY ETCH, LIGHTEN OR ALTER THE COLOR OF ACID SENSITIVE SURFACES.
<p>SULFAMIC ACID CLEANER</p>  <p>Coverage 3,000 to 16,000 Sq. Ft. Per 4# Jar</p>	<ol style="list-style-type: none"> 1. SWEEP OR VACUUM SURFACE TO BE CLEANED TO REMOVE ANY LOOSE CONTAMINANTS. 2. DISSOLVE SULFAMIC ACID CLEANER IN WATER TO MATCH CLEANING NEEDS: ¼ CUP TO 1 GALLON WATER – HEAVY DUTY; ½ CUP TO 1 GALLON WATER – MEDIUM DUTY; ¾ CUP TO 1 GALLON WATER – LIGHT DUTY 3. APPLY A LIBERAL AMOUNT OF WATER TO THE SURFACE TO BE CLEANED. 4. APPLY SULFAMIC ACID CLEANER USING A SPONGAUSA™ SPONGE, OR A MOP OR BRUSH. EXPERT TIP: FOR LARGE PROJECTS, DIVIDE WORKING AREA INTO MANAGEABLE SECTIONS OF APPROX. 25 SQ. FT. 5. ALLOW SULFAMIC ACID CLEANER TO DWELL ON SURFACE FOR 1 TO 5 MINUTES. 6. AGITATE WITH A PRIMO TOOLS™ WHITE NYLON SCRUB PAD, OR A BRUSH OR OTHER COMPARABLE NON-MARRING SCRUBBING TOOL UNTIL CONTAMINATE OR STAIN IS REMOVED FROM SURFACE. 7. THOROUGHLY RINSE SURFACE WITH WATER. A WET/DRY VACUUM MAY ALSO BE USED. 8. SOME SURFACES MAY REQUIRE ADDITIONAL APPLICATIONS. EXPERT TIP: HIGH-PRESSURE (1000 – 3000 PSI) SPRAYERS ARE HIGHLY EFFECTIVE AT RINSING AWAY CONTAMINATES AND STAINS WHEN USED IN CONJUNCTION WITH SULFAMIC ACID CLEANER. 9. WIPE SURFACE COMPLETELY DRY USING A CLEAN, DRY, WHITE COTTON OR MICRO-FIBER TOWEL. 10. IF SURFACE IS TO BE SEALED, ALLOW SURFACE TO DRY 24 HOURS PRIOR TO APPLYING A HIGH QUALITY OMNI SEALER

Technical Support: 949-709-5270 Mon thru Fri 6:00am PT to 4:00pm PT and/or E-mail TechSupport@OMNI-Sealers.com.

Problem Solving Guide is a general recommendation. Actual results may vary. Read product directions thoroughly before use.
ALWAYS TEST IN A SMALL INCONSPICUOUS AREA.